



NORTH AMERICAN AVIATION, INC • MUNICIPAL AIRPORT • LOS ANGELES 45, CALIF

NO. 23
April 11, 1947

MANDATORY--MUST BE
ACCOMPLISHED BY 8-1-47


CARBURETOR VAPOR RETURN LINE HOSE REPLACEMENT

AIRPLANES AFFECTED:

NAV-4-2 through NAV-4-850.

Airplanes NAV-4-851 and subsequent will have the metal vapor return line routed through the firewall in such a manner that a fire resistant hose is not required. Fire resistant hose is identified by a broken red and a broken white stripe running lengthwise of the hose.

Install 76701 fire resistant hose furnished in 145-89027 kit as shown:

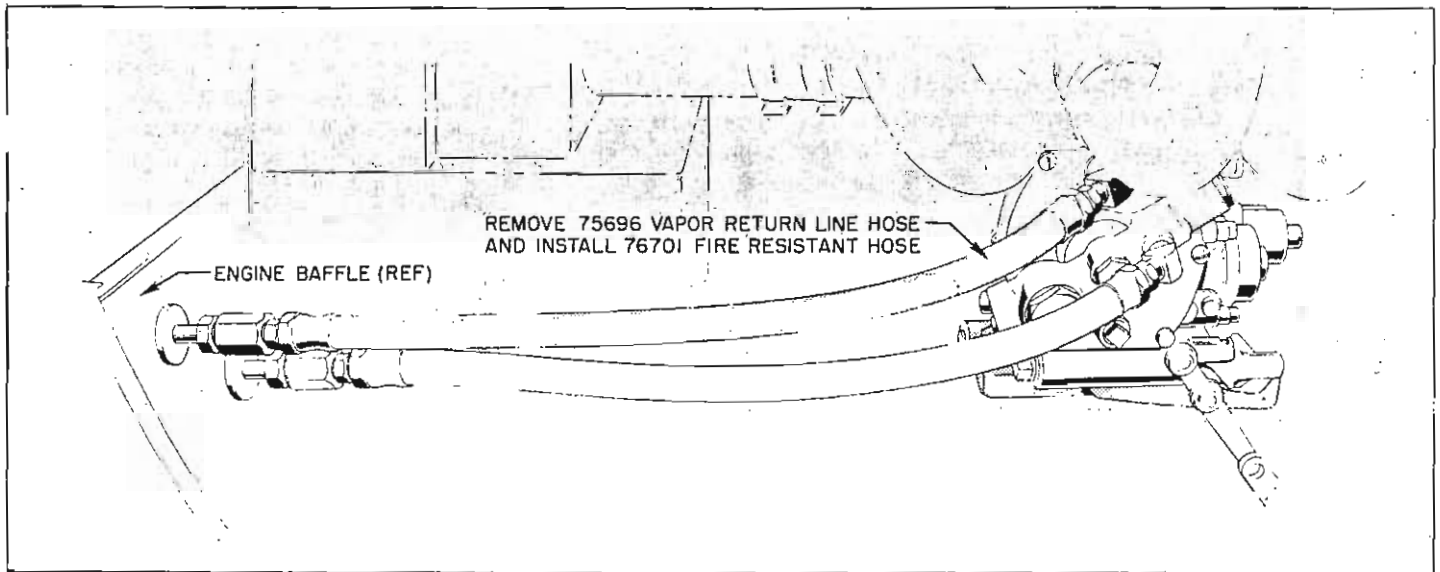

Compliance with this bulletin must be entered in airplane log book.

Warranty adjustments will be based on a Standard Time Allowance of .3 hour.

If you have sold your Navion, please return this kit to the factory with name and address of new owner.

JOHN W. CASEY
FIELD SERVICE MANAGER